

RWY	DIRECTION (MAGNETIC)	THR	BEARING STRENGTH
15R	153°	37°28'54"N 126°26'11"E	PCN 88/F/B/X/T Asphalt (SWY and 300 m RWY ends are 86/R/B/X/T Concrete)
33L	333°	37°27'15"N 126°27'39"E	PCN 88/F/B/X/T Asphalt (SWY and 300 m RWY ends are 86/R/B/X/T Concrete)
15L	153°	37°29'02"N 126°26'25"E	PCN 88/F/B/X/T Asphalt (SWY and 300 m RWY ends are 86/R/B/X/T Concrete)
33R	333°	37°27'23"N 126°27'53"E	PCN 88/F/B/X/T Asphalt (SWY and 300 m RWY ends are 86/R/B/X/T Concrete)
16	153°	37°28'22"N 126°24'56"E	PCN 75/F/B/X/T Asphalt (SWY and 700 m RWY ends are 85/R/B/X/T Concrete)
34	333°	37°26'36"N 126°26'30"E	PCN 75/F/B/X/T Asphalt (SWY and 700 m RWY ends are 85/R/B/X/T Concrete)

TAXIWAY A, D 30 m WIDE CONCRETE PCN 86/R/B/X/T
TAXIWAY B, C 30 m WIDE ASPHALT PCN 88/F/B/X/T
TAXIWAY M 30 m WIDE CONCRETE PCN 85/R/B/W/T
TAXIWAY N 30 m WIDE ASPHALT PCN 75/F/B/W/T
PAX Terminal and Concourse A VDGs equipped

- HS 01 AIRCRAFT TAXIING ON TAXIWAY J FROM RUNWAY 15L AFTER LANDING USE CAUTION WHEN ATC UTILIZES RUNWAY 15R FOR TAKEOFFS. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 15R WITHOUT ATC AUTHORIZATION.
- HS 02 AIRCRAFT TAXIING ON TAXIWAY K FROM RUNWAY 33R AFTER LANDING USE CAUTION WHEN ATC UTILIZES RUNWAY 33L FOR TAKEOFFS. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 33L WITHOUT ATC AUTHORIZATION.
- HS 03 AIRCRAFT TAXIING ON TAXIWAY J FROM TAXIWAY D FOR TAKEOFF RUNWAY 33L USE CAUTION WHEN ATC UTILIZES RUNWAY 33R FOR LANDINGS. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 33R WITHOUT ATC AUTHORIZATION.
- HS 04 AIRCRAFT TAXIING ON TAXIWAY K FROM TAXIWAY D FOR TAKEOFF RUNWAY 15R USE CAUTION WHEN ATC UTILIZES RUNWAY 15L FOR LANDINGS. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 15L WITHOUT ATC AUTHORIZATION.
- HS 05 AIRCRAFT TAXIING ON TAXIWAY S FROM TAXIWAY N OR M FOR TAKEOFF RUNWAY 34 USE CAUTION WHEN ATC CHANGES RUNWAY 34 FROM LANDING RUNWAY TO DEPARTURE RUNWAY. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 34 WITHOUT ATC AUTHORIZATION.
- HS 06 AIRCRAFT TAXIING ON TAXIWAY N8 FROM TAXIWAY N OR M FOR TAKEOFF RUNWAY 16 USE CAUTION WHEN ATC CHANGES RUNWAY 16 FROM LANDING RUNWAY TO DEPARTURE RUNWAY. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 16 WITHOUT ATC AUTHORIZATION.
- HS 51, 52 WHEN AIRCRAFT IS HOLDING BEFORE TAXIWAY A OR M, OTHER AIRCRAFT SHALL PAY EXTRA CAUTION WHILE TAXIING AROUND A HOT SPOT.
- HS 53 - 69 AIRCRAFT SHALL PAY EXTRA CAUTION TO WATCH OUT VEHICLES WHILE TAXIING AROUND A HOT SPOT. AIRCRAFT SHALL PAY EXTRA CAUTION NOT TO PROCEED BEYOND THE ATC SERVICE BOUNDARY (MANEUVERING AREA) WITHOUT CLEARANCE FROM INCHEON GROUND (TOWER) OR APRON.

LEGEND	
	VOR CHECK-POINT AND FREQUENCY
	Stop-bar light
	Runway Holding Position
	Taxi lane
	Gate
	Remote stand
	Open Channel
	ATC service boundary (Maneuvering Area)
	Transfer of Control Point (TCP)
	Hot Spot



Note
Aircraft shall not taxi into maneuvering area without clearance from Incheon Tower or Ground.

Change : Establishment of ACFT stand NR. 653~655 and Withdrawal of de-icing pad NR. 824.

LIGHTING AND
MARKING
CHART

SEOUL / Incheon Intl

MARKING AIDS RWY 15R/33L,15L/33R,16/34 AND EXIT TWY

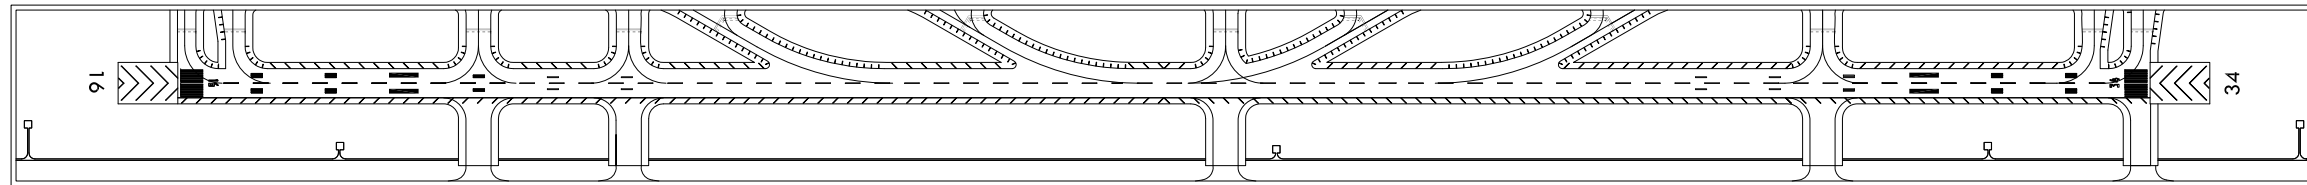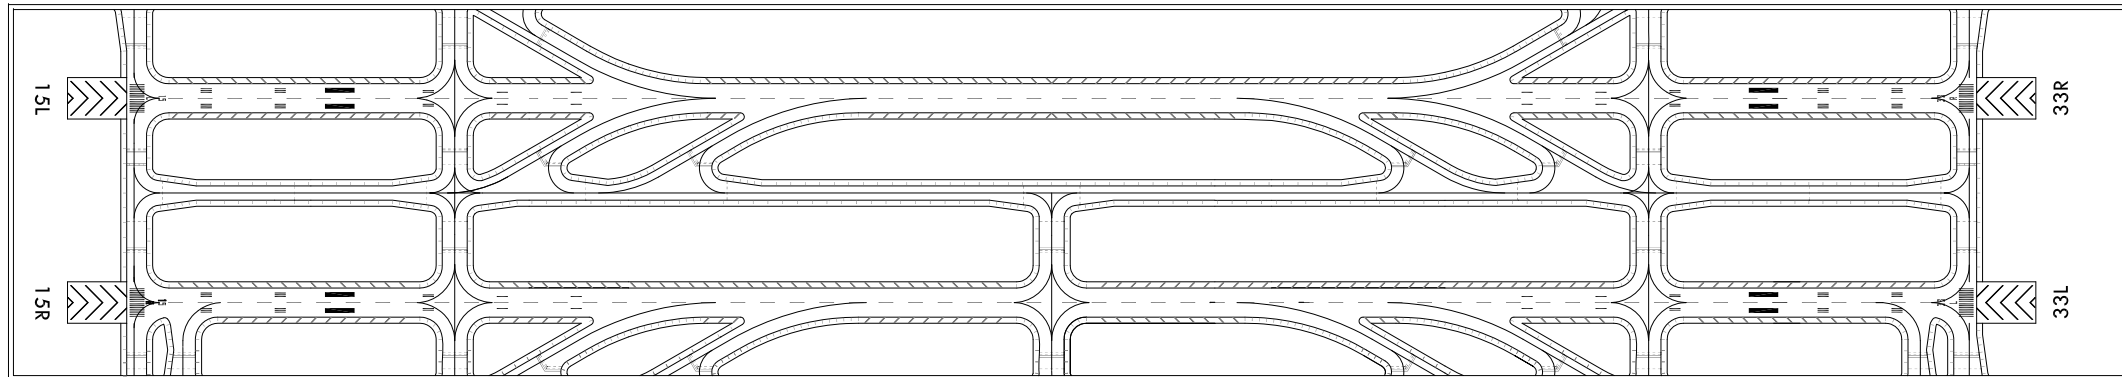

LIGHTING AIDS RWY 15R/33L,15L/33R,16/34 AND EXIT TWY

